

WITNESS MONUMENT TIES:

- A. 0.15'x0.15' square galvanized post for "Adopt A Road -Friends of Valley Mission Road" sign;
N87°W 73.6'
- B. Southeast corner of a 1.3' x 0.8' x 2.3' tall decorative limestone post;
N1°E 43.9'
- C. Southwest corner of concrete path to small cemetery;
N60°E 71.9'

MONUMENT ACCESSORIES:

- (#725) 5/8" rebar with 0.3' aluminum cap stamped "Monroe Co. Surveyor 103S" found 0.3' below grade;
N71° 21' 52"W 87.74'
- (#5013) PK nail found flush in centerline of Valley Mission Road, Lawrence County Section Corner A17 common to Sections 2 & 3-T6N-R1W;
N72° 26' 55"W 52.07'
- (#5106) Railroad spike found 0.1' below grade in the centerline of Valley Mission Road;
N5° 35' 09"W 15.85'



OTHER ACCESSORIES:

A 5' steel t-post was set 3.2' above grade, 0.35' south of the stone. A Monroe County Surveyor Marker sign was attached 2.2' above grade facing north. A magnet was planted on the south side of the stone. The stone was painted orange and the broken top was set back on the base and reburied. Several rocks were placed around the broken and exposed top of the stone, but not enough to be described as a cairn.

OTHER OBSERVATIONS:



The stone was found 7.9' south of the south edge of asphalt of Valley Mission Road, in line with the remains of east/west fence.

Section 34 T07N-R01W Clear Creek	Section 35 T07N-R01W Clear Creek
Section 3 T06N-R01W Lawrence	Section 2 T06N-R01W Lawrence

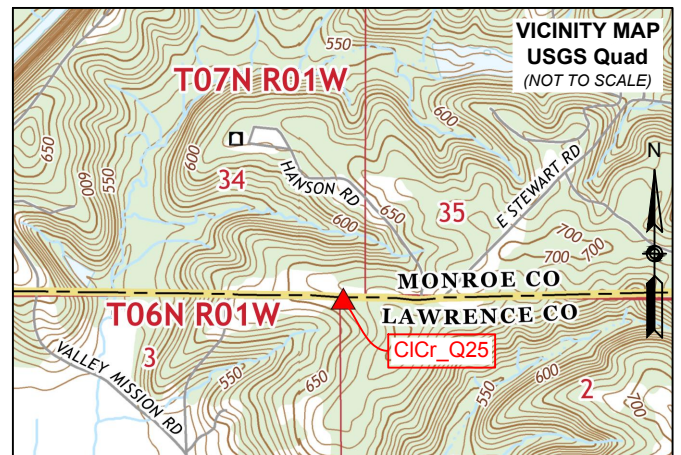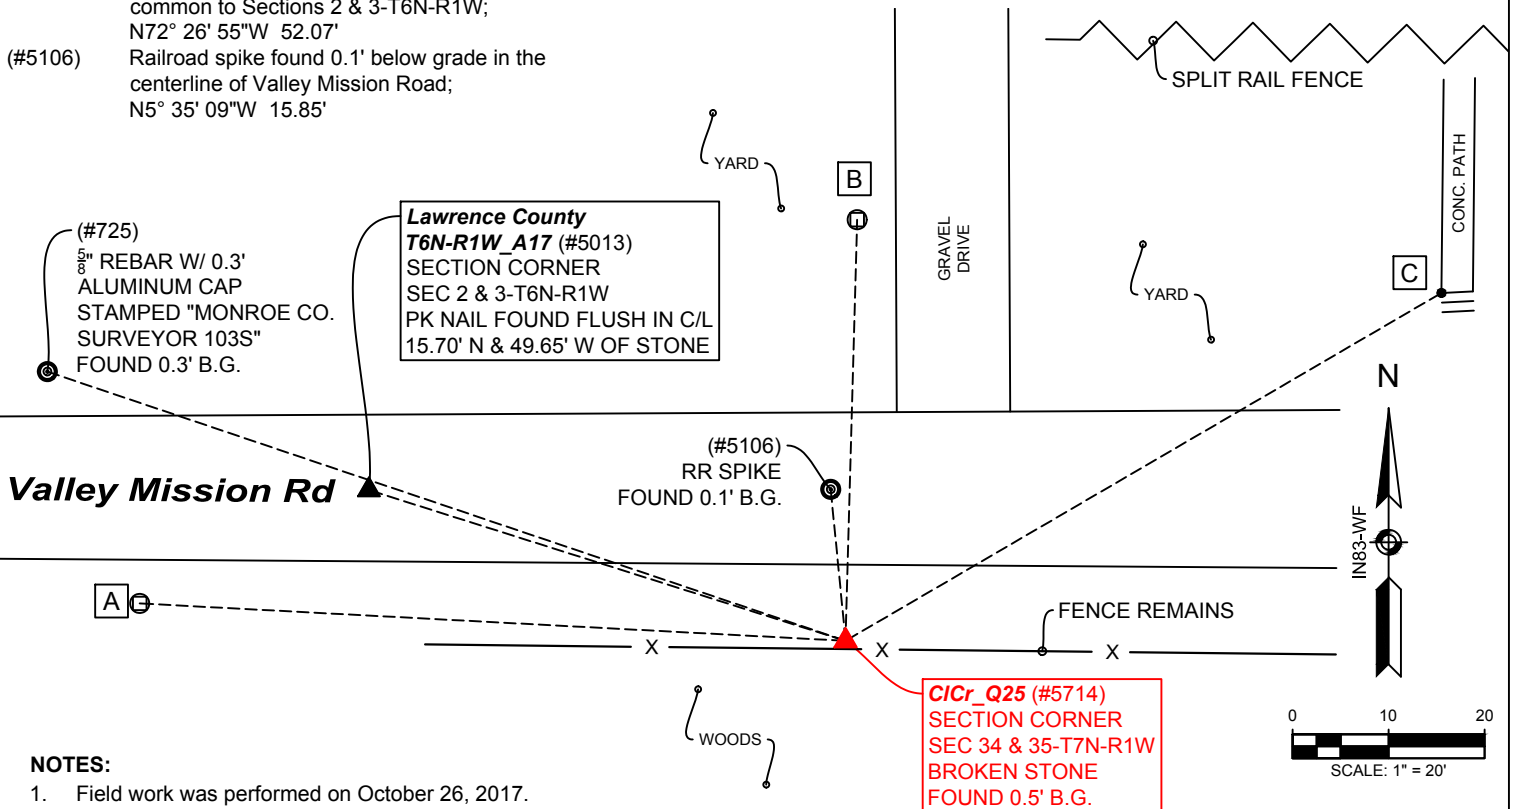

▲ **Monument Description:** A 0.9' x 0.25' limestone with no markings was found broken off 0.5' below grade. We located the center of the base, planted a magnet on the south side, placed the broken top on the base, painted it orange, and reburied it.
State Plane Grid Coordinates: Northing: 1363973.5', Easting: 3118937.2'

SHEET 1 OF 3	MONUMENT RECORD CORNER ID: CICr_Q25	Section Corner Section 34 & 35- T07N-R01W Clear Creek Township Monroe County, Indiana	MONROE COUNTY GOVERNMENT	OFFICE OF THE MONROE COUNTY SURVEYOR Trohn Enright-Randolph Monroe County Surveyor Rachel Savich Oser Professional Surveyor 119 West 7th Street, Bloomington, IN 47404 (812) 349-2570
-----------------------	---	---	---	---

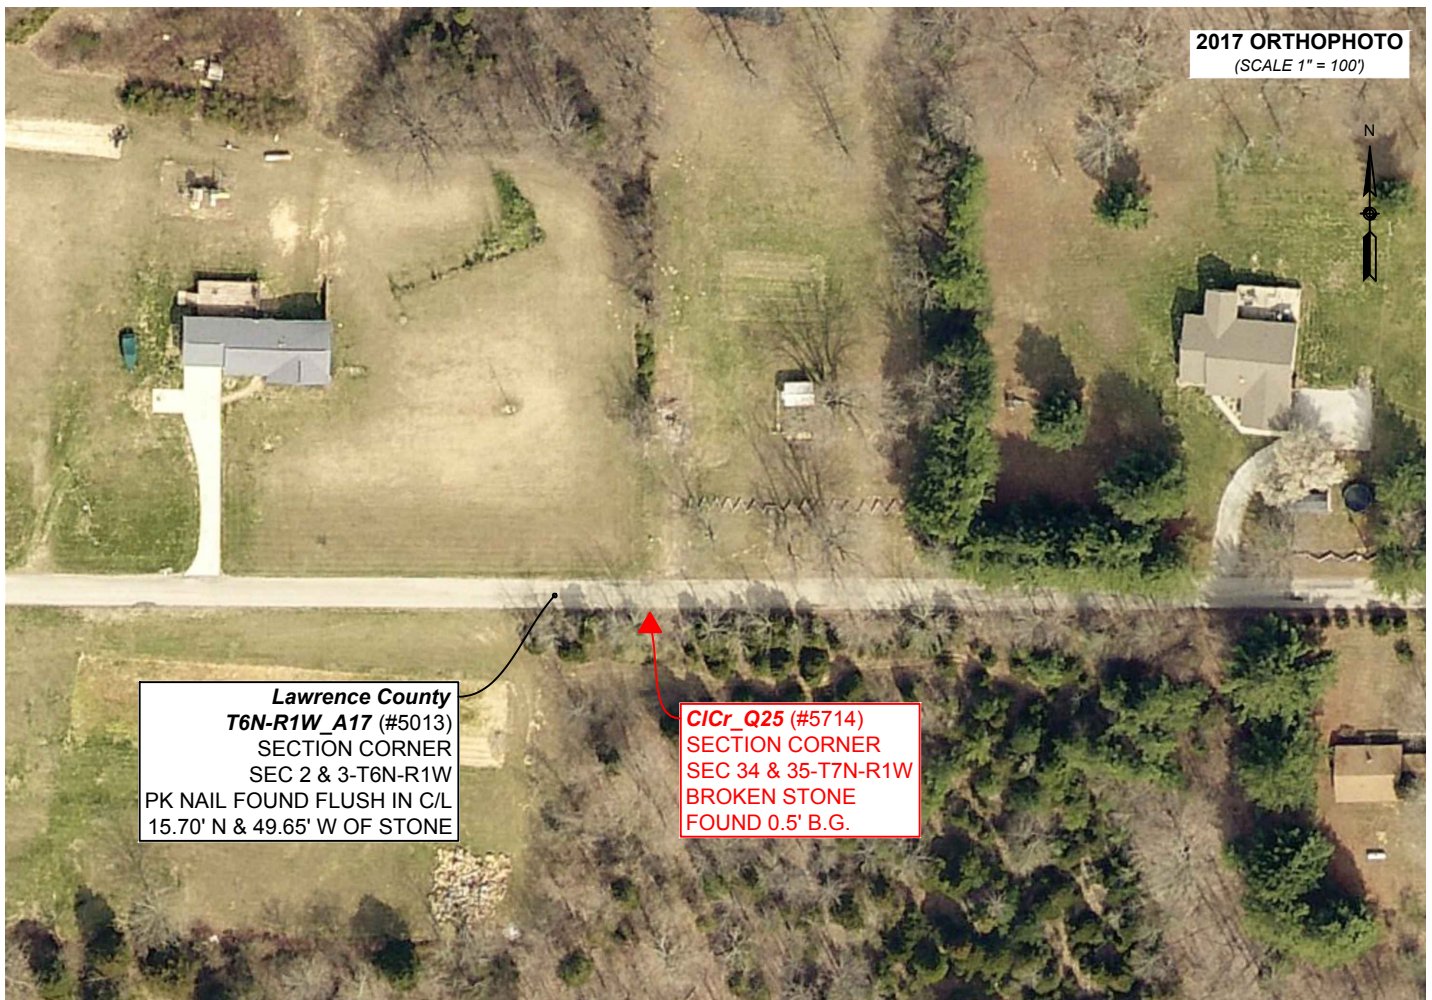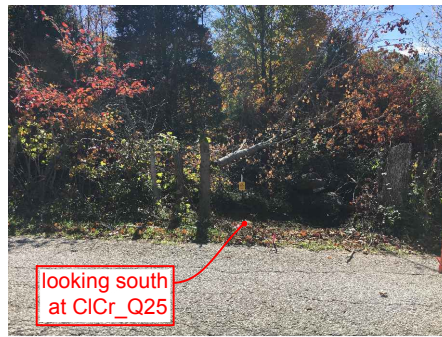

SHEET
2
OF
3

MONUMENT RECORD
CORNER ID:
C1Cr_Q25

Section Corner
Section 34 & 35- T07N-R01W
Clear Creek Township
Monroe County, Indiana



MONROE COUNTY SURVEYOR'S OFFICE
Trohn Enright-Randolph *Monroe County Surveyor*
Rachel Savich Oser *Professional Surveyor*
119 West 7th Street, Bloomington, IN 47404 (812) 349-2570

ORIGINAL GOVERNMENT SURVEY:

Year Surveyed: 3/31/1811 By: Arthur Henrie
MCS Page: 199

Original monument: *Wooden Post*

Bearing Trees or Reference Monuments:

Species	Dia.	Bearing	Dist.(lks)	Dist. (ft)
Beech	15"	N52°E	8 lks	5.3'
Beech	9"	S75°W	13 lks	8.6'

Notes: *Lawrence Co. closing corner record distance is 75 lks west = 49.5'*

SUBSEQUENT CORNER RESTORATION:

Date Surveyed: 5/21/1839 By: James Spencer

Where filed or recorded: MCS-LSB1, pg 63

Monument: *Not specified*

Bearing Trees or Reference Monuments:

Species	Dia.	Bearing	Dist.(lks)	Dist. (ft)
Beech	15"	N52°E	8 lks	5.3'
Beech	9"	S75°W	13 lks	8.6'

SUBSEQUENT CORNER RESTORATION:

Date Surveyed: 11/24/1871

By: Alexander Spencer

Where filed or recorded: MCS-LSB2, pg 182

Monument: *Not specified*

Bearing Trees or Reference Monuments: *No witnesses*

Notes: *Spencer began 80 poles west of this corner*

SUBSEQUENT CORNER RESTORATION:

Date Surveyed: 5/13/1996

By: Michael Friley

Where filed or recorded: MCS Monument Record

Monument: *Found railroad spike*

Bearing Trees or Reference Monuments:

Species	Dia.	Bearing	Dist. (ft)
twin ash/pk	8"	S28°W	14.70'
ash/pk	8"	S64°E	33.51'
se corner conc. porch		N64°E	91.96'

SUBSEQUENT CORNER RESTORATION:

Date Surveyed: 7/8/2004 By: Eric Deckard

Where filed or recorded: MCS Monument Record

Monument: *Found railroad spike*

Bearing Trees or Reference Monuments:

Species	Dia.	Bearing	Dist. (ft)
Sign		S85°W	72.4'
twin ash		S35°W	14.0'
witness mon.		N81°W	82.6'

MONUMENTATION: A 0.9' x 0.25' limestone with no markings was found broken off 0.5' below grade.

ORIGIN: The original GLO surveyor set a wooden post at this corner. No evidence of the original monument or its accessories was found. In May of 1839, James Spencer (Reference Survey ID 000024 - Monroe County Survey Book 2, page 63) witnessed this corner, but did not indicate a monument type, or if the monument was found or set. In November of 1871, Alexander Spencer (Reference Survey ID 000023 - Monroe County Survey Book 2, pages 182-183) began his survey 80 poles west of this corner but did not take any new accessories. Stones were found at several of the other corners shown on the 1871 Spencer survey. This stone was accepted with no associated uncertainty.

HISTORY AND SEARCH PROCEDURE: On a 1975 unrecorded survey on file in the office of the Monroe County Surveyor (Reference Survey ID 000048), Harold Howell depicts a monument in line with an east/west fence on the south side of Valley Mission Road. On a 1988 unrecorded survey on file in the office of the Monroe County Auditor (Reference Survey ID 000053), Harold Howell labeled the SW corner of Section 35 on the south side of the road and showed a railroad spike at the intersection of the section line and the centerline. This survey appears to be the origin of the railroad spike that was found 15.85 north of the stone. In 1996, Ben Bledsoe accepted the railroad spike on a boundary survey for Joe Watson in the Southeast quarter of the Southwest quarter of Section 35-T7N-R1W (Reference Survey ID 000042 - Instrument Number 710300). A few months after the Bledsoe survey, the Monroe County Surveyor, Michael Friley certified the railroad spike as the section corner. Neither Friley nor Bledsoe mentioned the stone. The railroad spike also appears to have been used by the Lawrence County Surveyor Mike Arena to establish the closing corner to the west, which is a pk nail in the centerline of Valley Mission Road. In 2004, the railroad spike was again certified by the Monroe County Surveyor as the section corner.

The stone is located about 8' south of the south edge of asphalt of Valley Mission Road, in line with the remains of an east/west barbed wire fence. There is also a clear north/south tree line on the north side of Valley Mission Road.

The first time I visited this corner, I located the railroad spike that is currently certified as the section corner by this office. The railroad spike didn't check very well with stones that I found a quarter mile to the north and west, so I looked around near the fence remains on the south side of the road with a rake, probe, shovel, and metal detector, but I didn't find anything. When I came across the 1975 Howell survey that seems to depict a stone, I calculated a point and went back to the corner to search more thoroughly. I hit the broken top of the stone about a foot from the calculated point. The base of the stone was found below the broken off top approximately 1.6' southeast of the calculated point. The stone does not have any markings, but it is similar to the stones found to the north and west (limestone, with a tapered top).

OTHER OBSERVATIONS: There is a Lawrence County Surveyor pk nail 15.7' north and 49.65' west of the stone. The Lawrence County Surveyor, Corey Allen, and the former Lawrence County Surveyor, Mike Arena, both agreed that the stone we found at this corner was better evidence of the section line. Corey Allen intends to set a new offset monument for the Lawrence County line, preserving the pk nail as a reference and a possible property corner. It is also probable that there are property rights associated with the railroad spike.


PERPETUATION: This monument was accepted by the Monroe County Surveyor Review Board on [insert date]. The monument was located and witnessed on October 26, 2017 (MCS Field Book 50, page 80). A 5' steel t-post was set 3.2' above grade, 0.35' south of the stone. A Monroe County Surveyor Marker sign was attached 2.2' above grade facing north. A magnet was planted on the south side of the stone. The stone was painted orange, and the broken top was set back on the base and reburied.



Trohn Enright-Randolph
Trohn Enright-Randolph
Monroe County Surveyor



Accepted by the Monroe
County Surveyor Review Board
on March 20, 2018

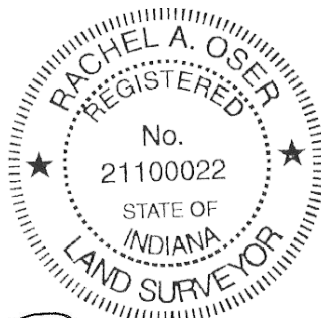

Rachel Oser
Rachel Savich Oser
Indiana P.S.21100022

SHEET
3
OF
3

MONUMENT RECORD
CORNER ID:
CICr_Q25

Section Corner
Section 34 & 35- T07N-R01W
Clear Creek Township
Monroe County, Indiana



MONROE COUNTY SURVEYOR'S OFFICE
Trohn Enright-Randolph Monroe County Surveyor
Rachel Savich Oser Professional Surveyor
119 West 7th Street, Bloomington, IN 47404 (812) 349-2570


MONUMENT RECORD

STATE OF INDIANA~COUNTY OF MONROE

Section: 34, Township: 7 NORTH, Range: 1 WEST,

Monument Description & Remarks: R.R. SPIKE

Recovery Tie Drawing

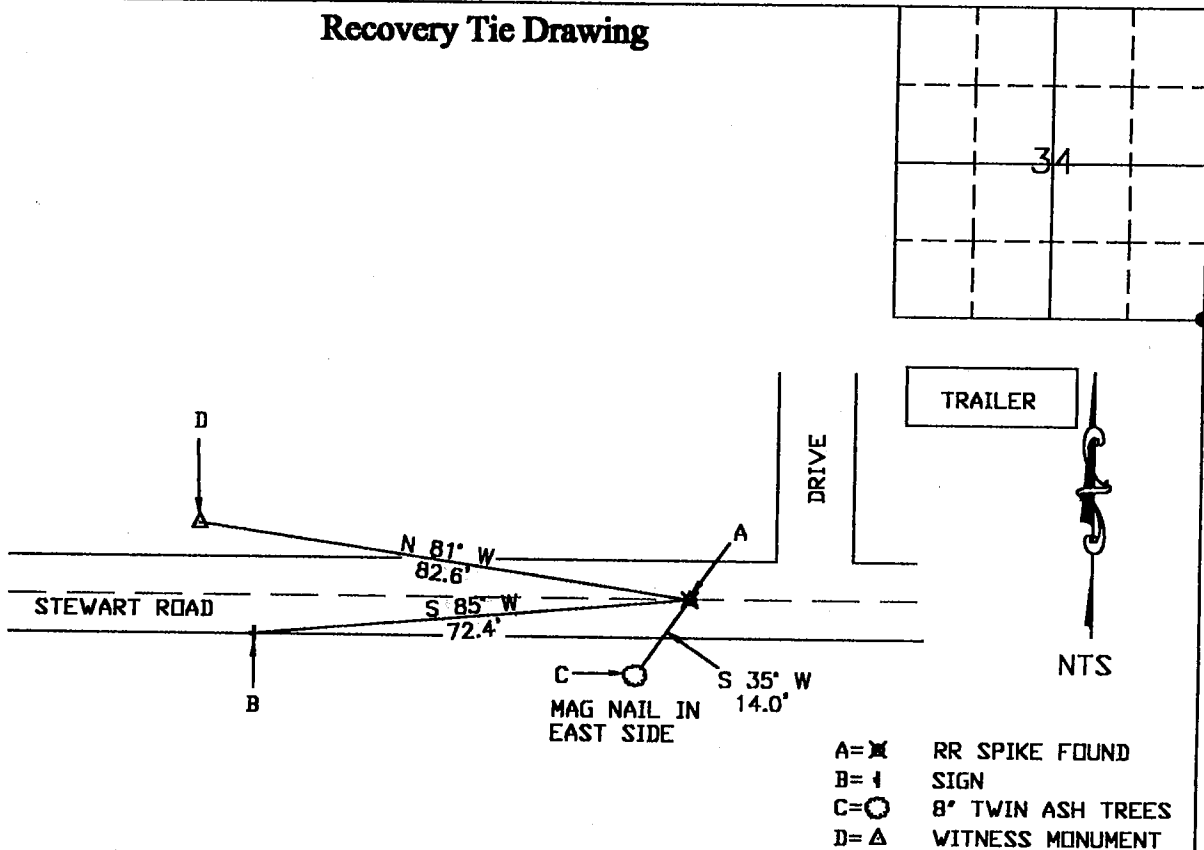

Section Corner: R.R. SPIKE

Northing: 1363989.447 Easting: 3118935.625


Witness: 103 S

Northing: 1364001.700 Easting: 3118853.989 Elev: 660.36

State Plan Coordinate (NAD83 Survey Feet, Indiana West Zone)

I, Eric Lee Deckard, here by certify that this document was prepared under my direction in accordance with the provisions of Section 17-3-64-4 through 17-3-64-8 of the Indiana Code, being Acts of 1965, Chapter 319, this 8th day of JULY, 2004 A.D.
Completed by Steven V. Farkas, Monroe County Surveyor

[Signature]
Indiana Registered Land Surveyor No. LS 29900012

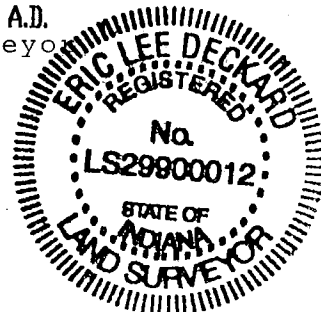

MONUMENT RECORD


Corner I.D. #

Q-25

STATE OF INDIANA - COUNTY OF MONROE

Section Thirty-four, 34, Township 7 North, Range 1 West

Monument Description & Remarks: Found Railroad Spike, 1/2" below surface
in centerline. Railroad Spike marks the SE corner of section.

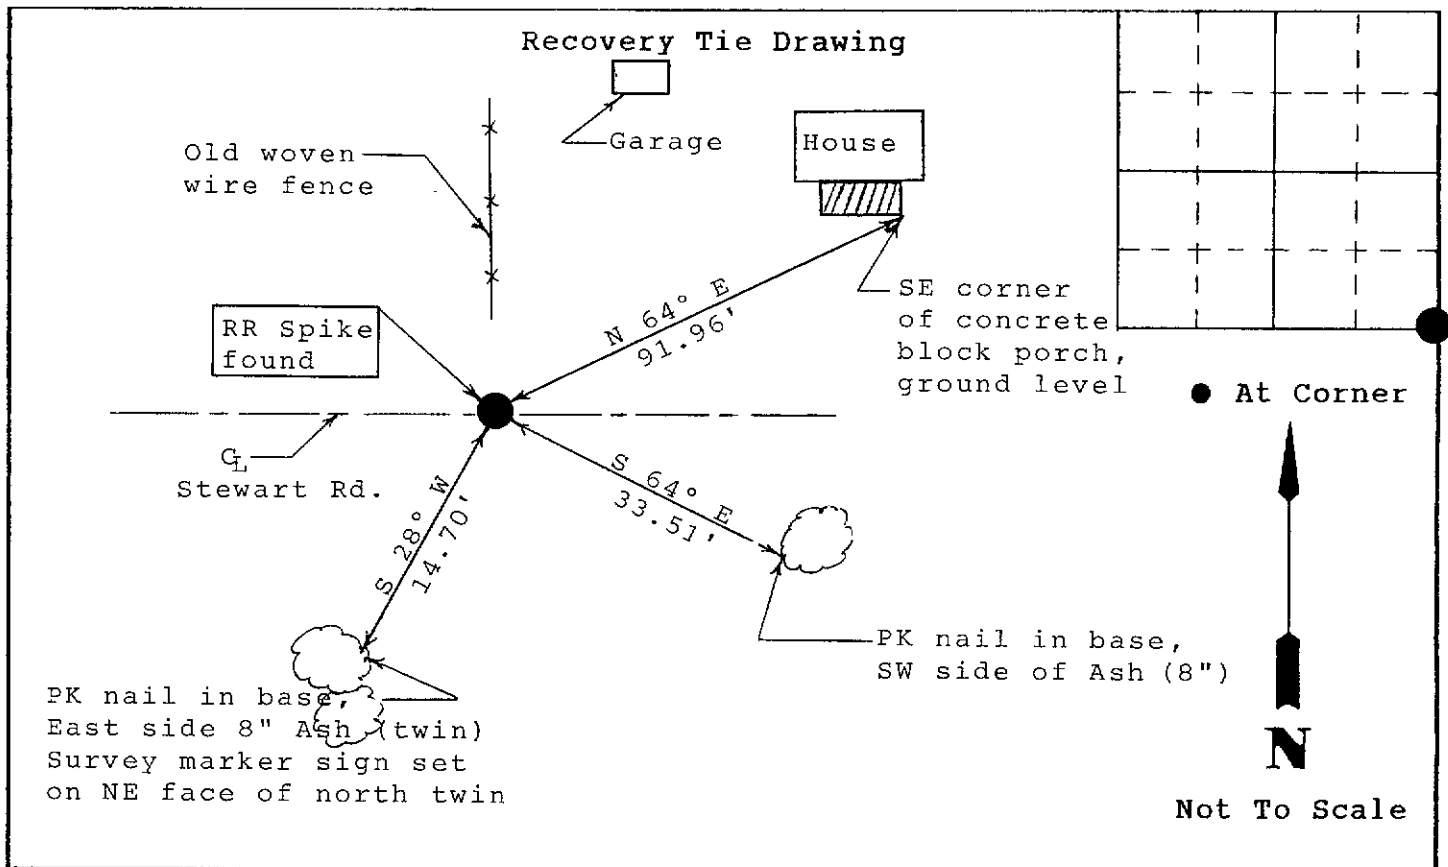

State of Indiana
County of Monroe

Space
Reserved For
Recording
Officer

I, Michael W. Friley, County Surveyor, hereby certify
that this document was prepared under my direction in
accordance with the provisions of Section 17-3-64-4
through 17-3-64-8 of the Indiana Code, being Acts of 1965,
Chapter 319; and the above data is given under my hand and
seal this 13th day of May, 1996 A.D.

Indiana Registered Land Surveyor No. _____ or

Monroe County Surveyor's Office
United States Government Agency

Monroe County Surveyor
Title

Field Book:

96-01

Page:

55